

PRODUCT DATA SHEET

Purolite® C160H

Polystyrenic Macroporous, Strong
Acid Cation Resin, Hydrogen form,
High Capacity

PRINCIPAL APPLICATIONS

- Demineralization

ADVANTAGES

- Excellent resistance to osmotic and thermal shock
- Excellent kinetics

REGULATORY APPROVALS

- Kosher Certified

TYPICAL PACKAGING

- 1 ft³ Sack
- 25 L Sack
- 5 ft³ Drum (Fiber)
- 1 m³ Supersack
- 42 ft³ Supersack

TYPICAL PHYSICAL & CHEMICAL CHARACTERISTICS:

Polymer Structure	Macroporous polystyrene crosslinked with divinylbenzene
Appearance	Spherical Beads
Functional Group	Sulfonic Acid
Ionic Form	H ⁺ form
Total Capacity	2.3 eq/L (50.3 Kgr/ft ³) (Na ⁺ form)
Total Capacity	2.3 eq/kg
Moisture Retention	43 - 48 % (H ⁺ form)
Moisture Retention	43-48 % (H ⁺ form)
Particle Size Range	300 - 1200 µm
< 300 µm (max.)	1 %
Uniformity Coefficient (max.)	1.7
Reversible Swelling, Na ⁺ → H ⁺ (max.)	4 %
Specific Gravity	1.21
Shipping Weight (approx.)	760 - 800 g/L (47.5 - 50.0 lb/ft ³)
Temperature Limit	120 °C (248.0 °F) (H ⁺ form)
Temperature Limit	140 °C (284.0 °F) (Na ⁺ form)



Americas
T +1 610 668 9090
F +1 610 668 8139
americas@purolite.com

EMEA
T +44 1443 229334
F +44 1443 227073
europe@purolite.com

Asia Pacific
T +86 571 876 31382
F +86 571 876 31385
asiapacific@purolite.com


FSU
T +7 495 363 5056
F +7 495 564 8121
fsu@purolite.com

Hydraulic Characteristics

PRESSURE DROP

The pressure drop across a bed of ion exchange resin depends on the particle size distribution, bed depth, and voids volume of the exchange material, as well as on the flow rate and viscosity of the influent solution. Factors affecting any of these parameters—such as the presence of particulate matter filtered out by the bed, abnormal compressibility of the resin, or the incomplete classification of the bed—will have an adverse effect, and result in an increased head loss. Depending on the quality of the influent water, the application and the design of the plant, service flow rates may vary from 10 to 40 BV/h.


PRESSURE DROP ACROSS RESIN BED

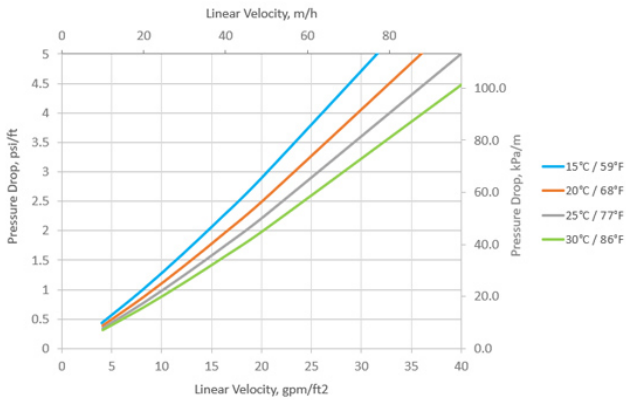

BACKWASH

During up-flow backwash, the resin bed should be expanded in volume between 50 and 70% for at least 10 to 15 minutes. This operation will free particulate matter, clear the bed of bubbles and voids, and reclassify the resin particles ensuring minimum resistance to flow. When first putting into service, approximately 30 minutes of expansion is usually sufficient to properly classify the bed. It is important to note that bed expansion increases with flow rate and decreases with influent fluid temperature. Caution must be taken to avoid loss of resin through the top of the vessel by over expansion of the bed.

BACKWASH EXPANSION OF RESIN BED

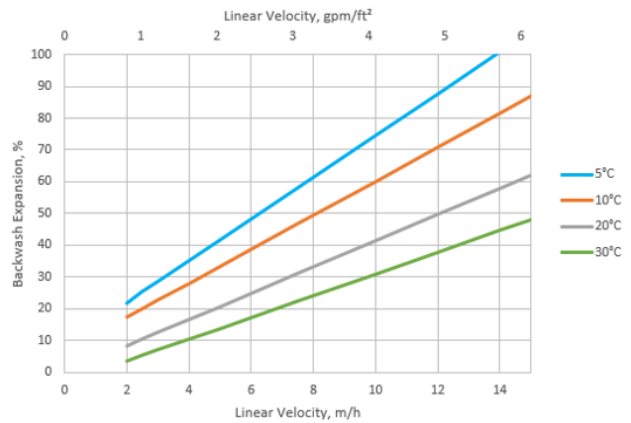

Americas
 T +1 610 668 9090
 F +1 610 668 8139
 americas@purolite.com

EMEA
 T +44 1443 229334
 F +44 1443 227073
 europe@purolite.com

Asia Pacific
 T +86 571 876 31382
 F +86 571 876 31385
 asiapacific@purolite.com

FSU
 T +7 495 363 5056
 F +7 495 564 8121
 fsu@purolite.com

The statements, technical information and recommendations contained herein are believed to be accurate as of the date hereof. Since the conditions and methods of use of the product and of the information referred to herein are beyond our control, Purolite expressly disclaims any and all liability as to any results obtained or arising from any use of the product or reliance on such information; NO WARRANTY OF FITNESS FOR ANY PARTICULAR PURPOSE, WARRANTY OF MERCHANTABILITY OR ANY OTHER WARRANTY, EXPRESSED OR IMPLIED, IS MADE CONCERNING THE GOODS DESCRIBED OR THE INFORMATION PROVIDED HEREIN. The information provided herein relates only to the specific product designated and may not be applicable when such product is used in combination with other materials or in any process. Nothing contained herein constitutes a license to practice under any patent and it should not be construed as an inducement to infringe any patent and the user is advised to take appropriate steps to be sure that any proposed use of the product will not result in patent infringement.



Americas

T +1 610 668 9090
F +1 610 668 8139
americas@purolite.com

EMEA

T +44 1443 229334
F +44 1443 227073
europe@purolite.com

Asia Pacific

T +86 571 876 31382
F +86 571 876 31385
asiapacific@purolite.com

FSU

T +7 495 363 5056
F +7 495 564 8121
fsu@purolite.com